



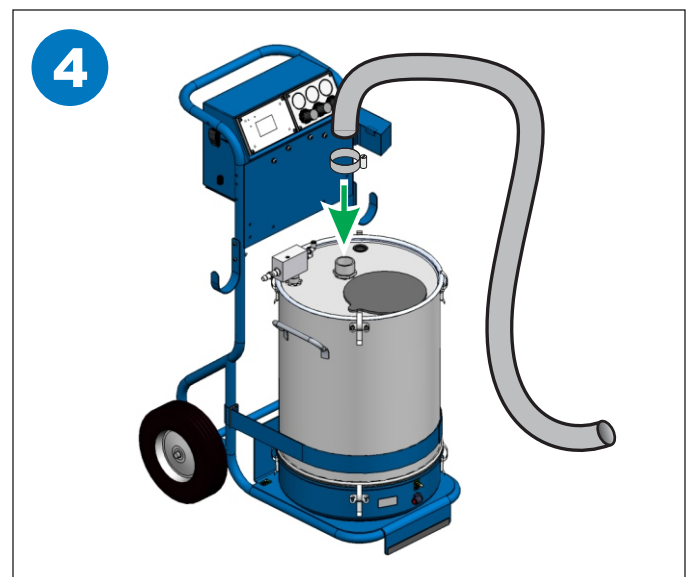
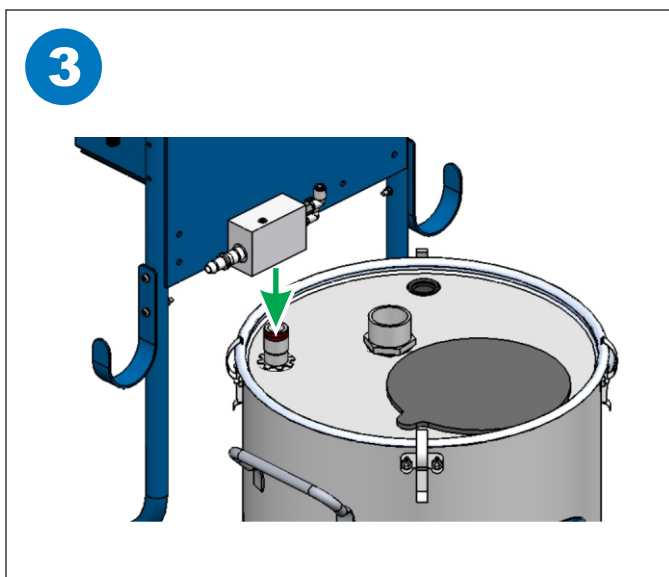
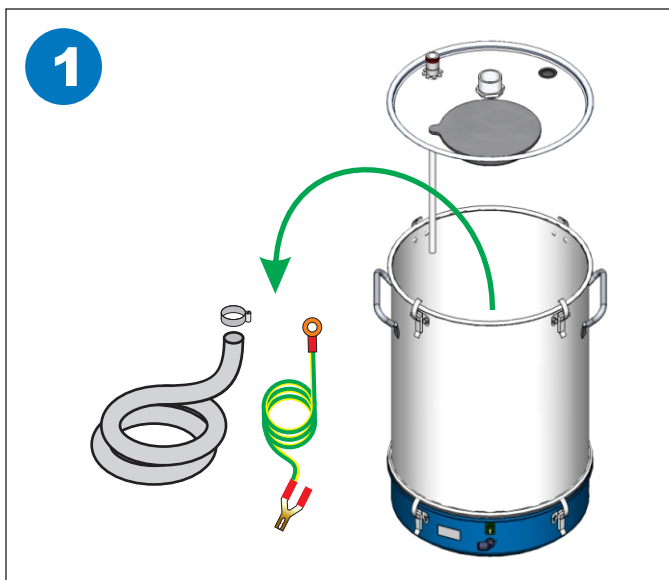
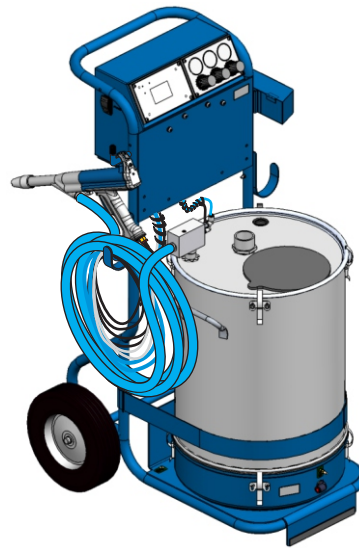
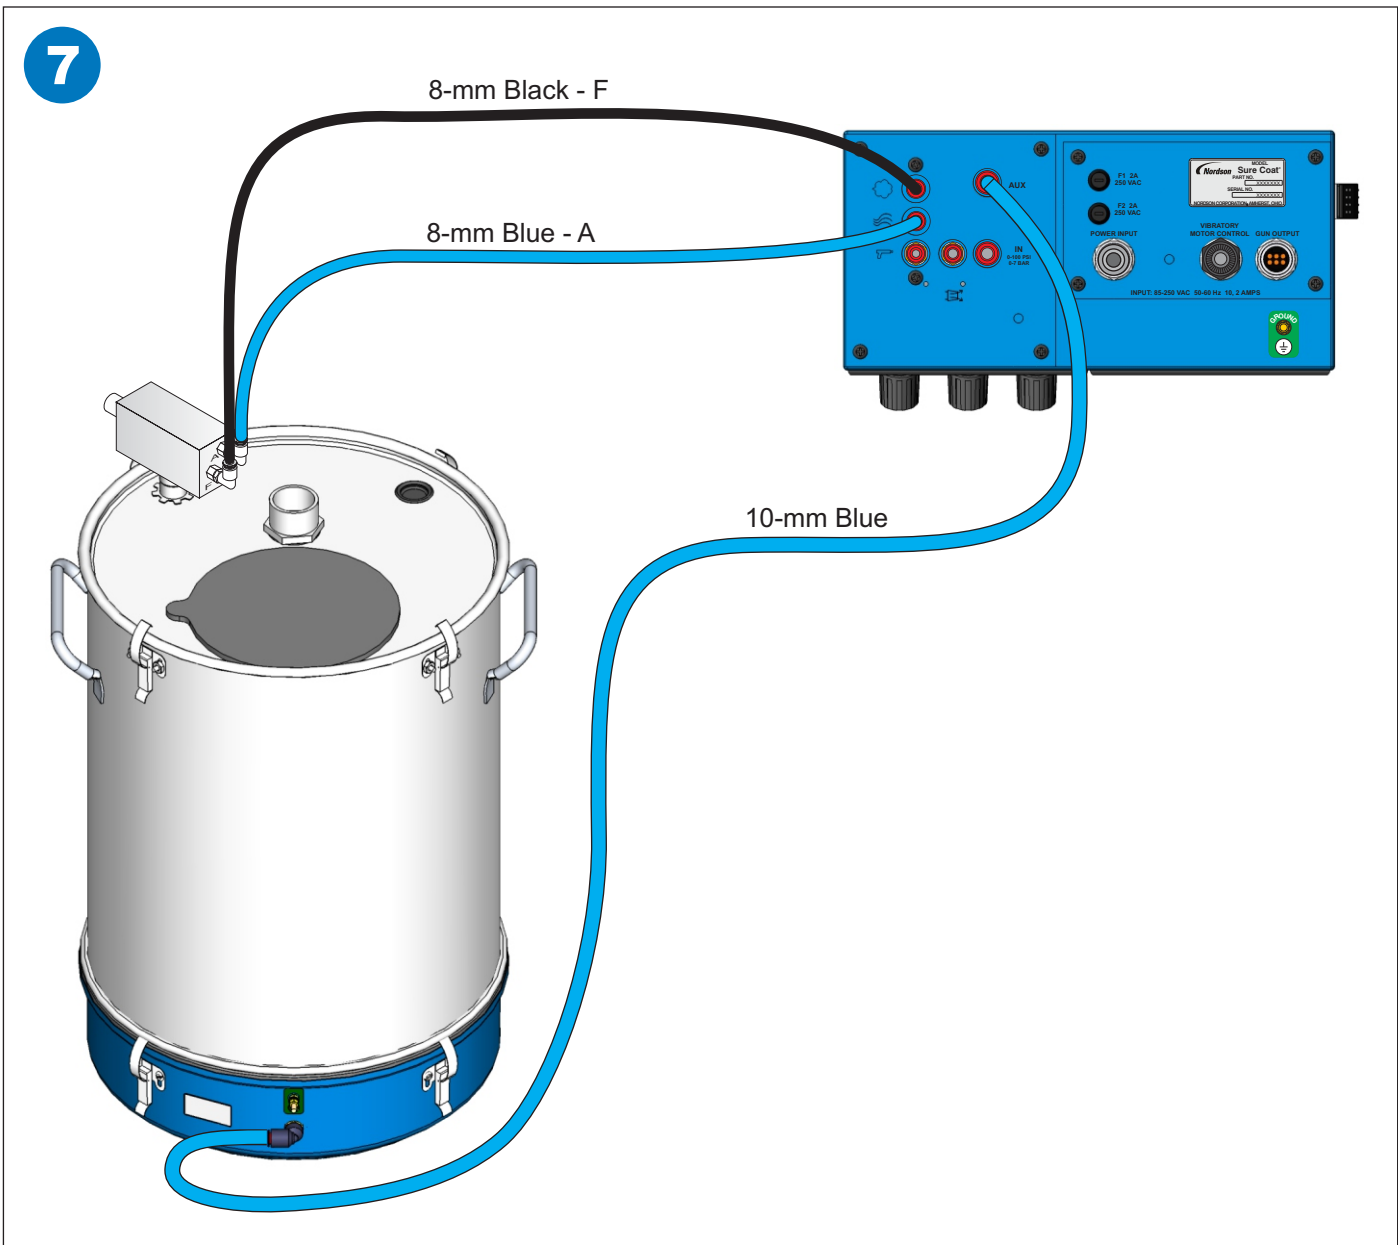






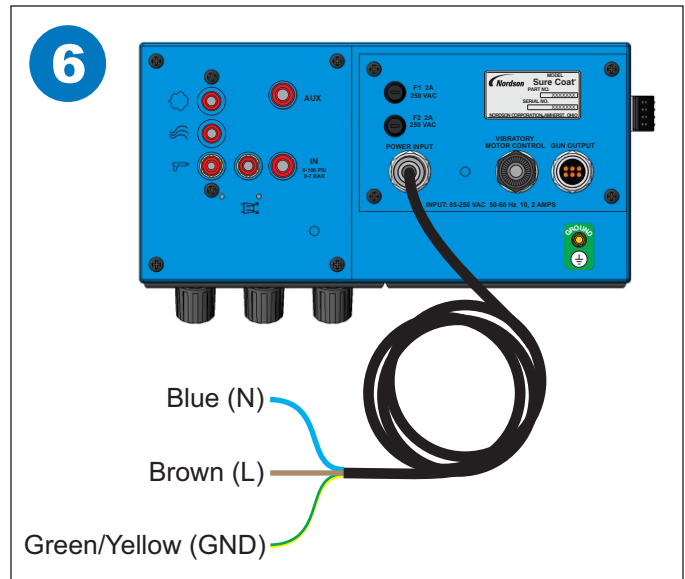


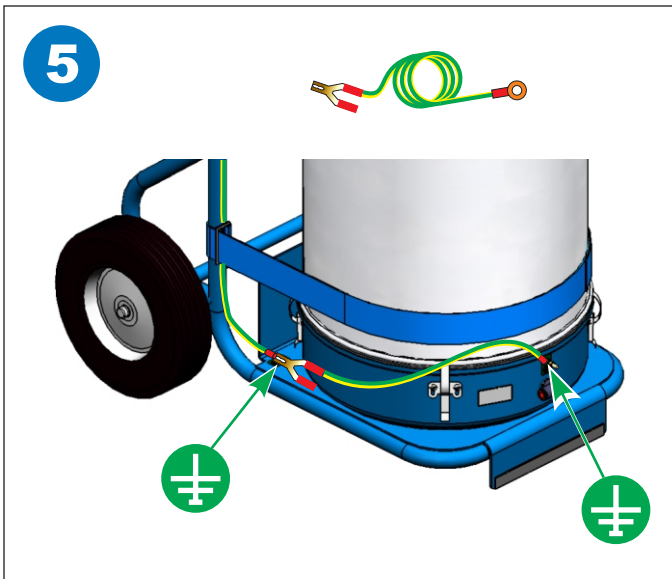


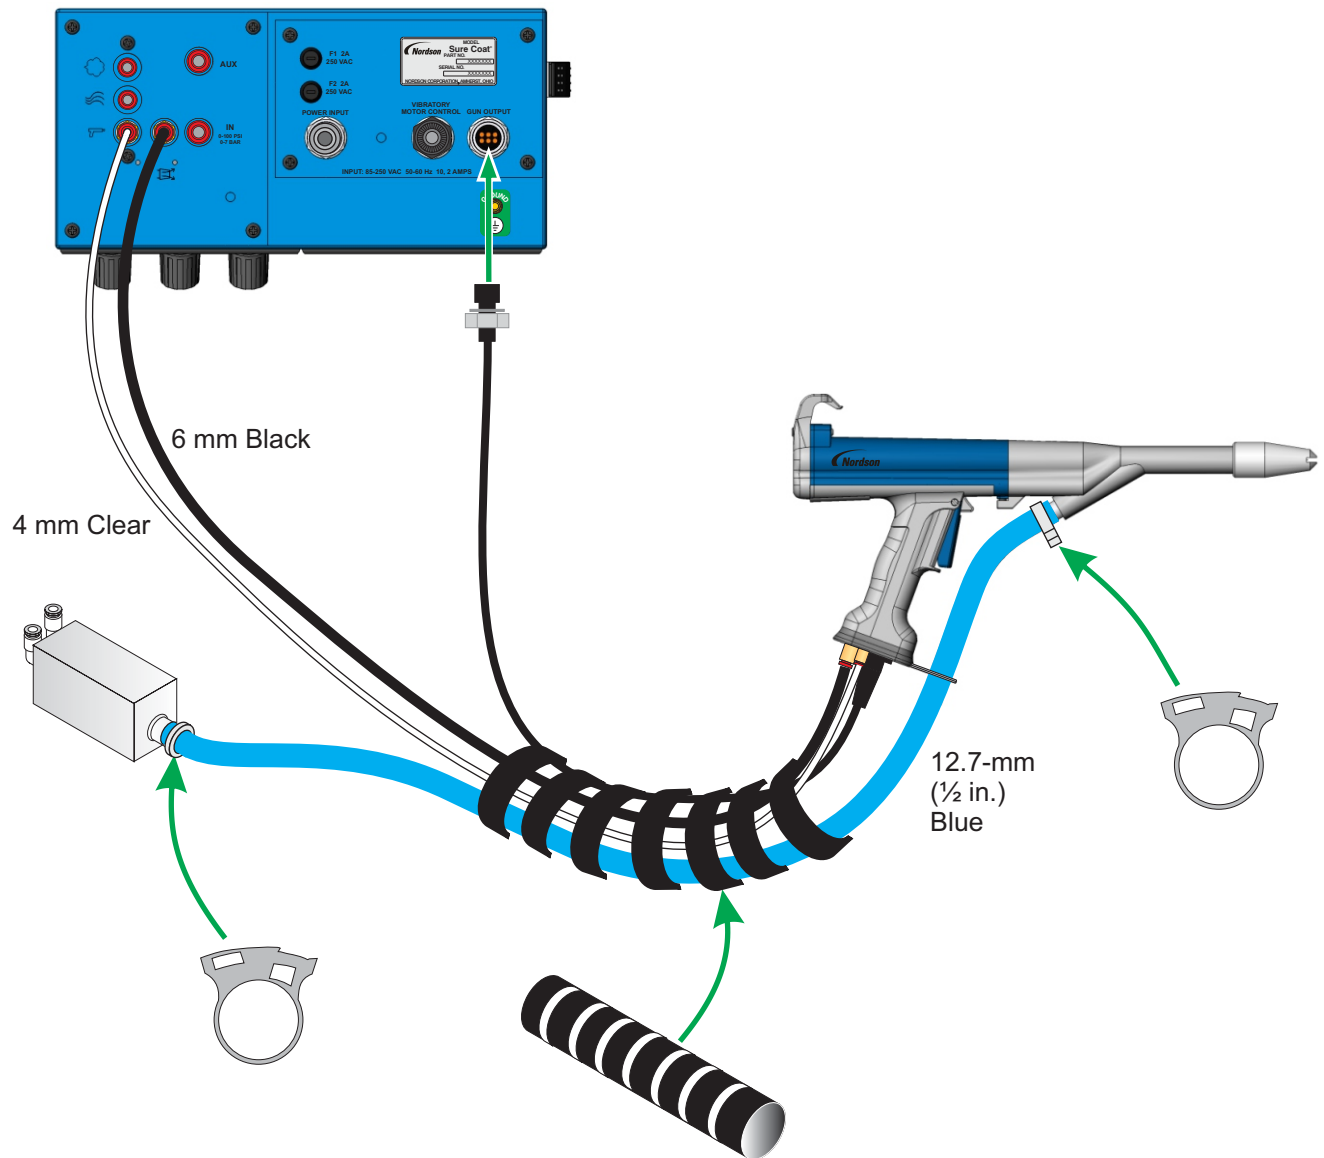


9

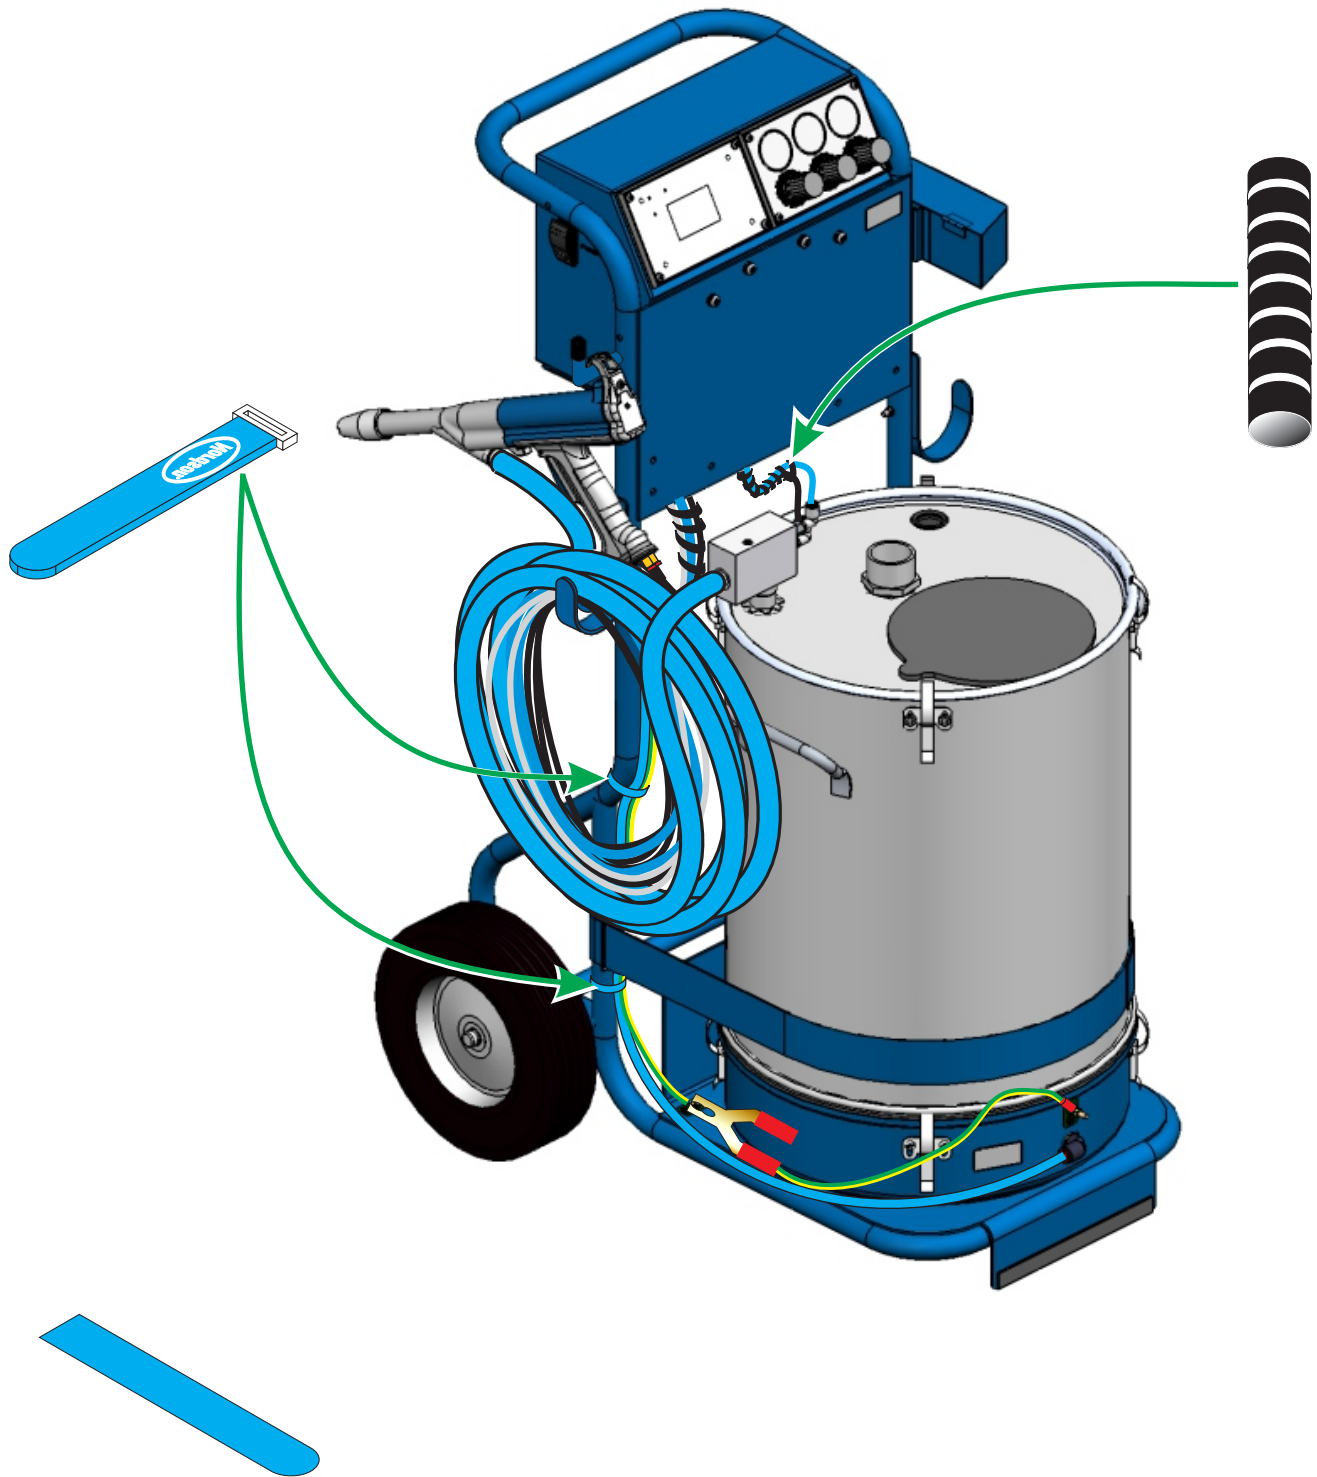

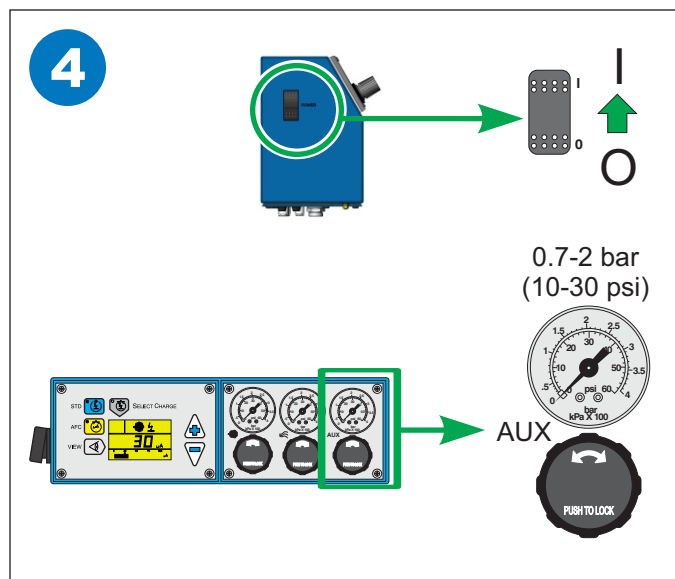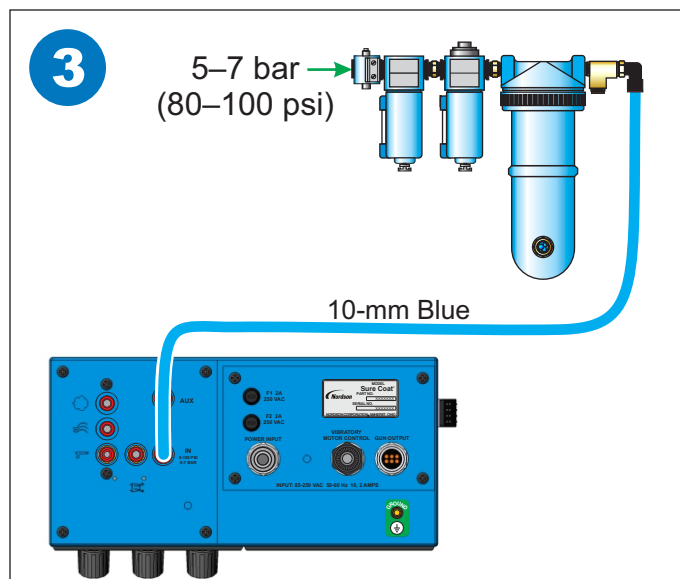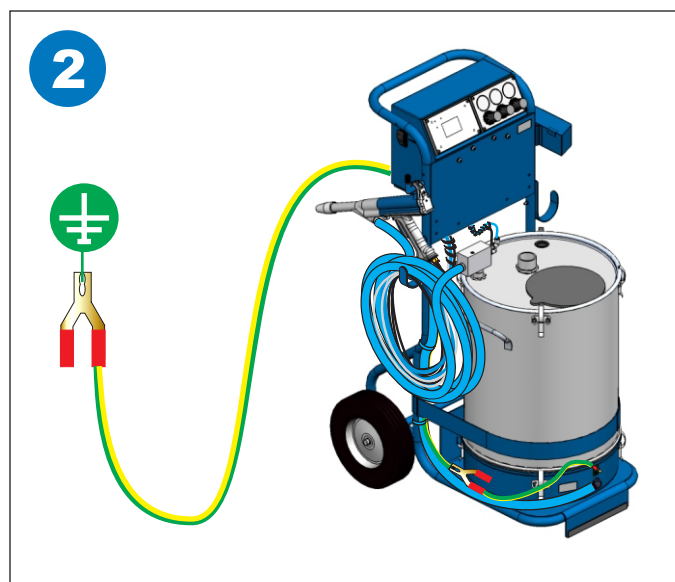
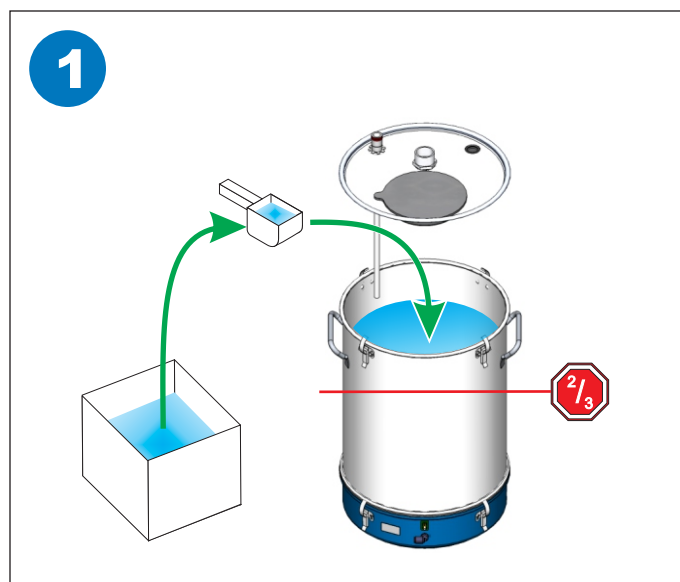
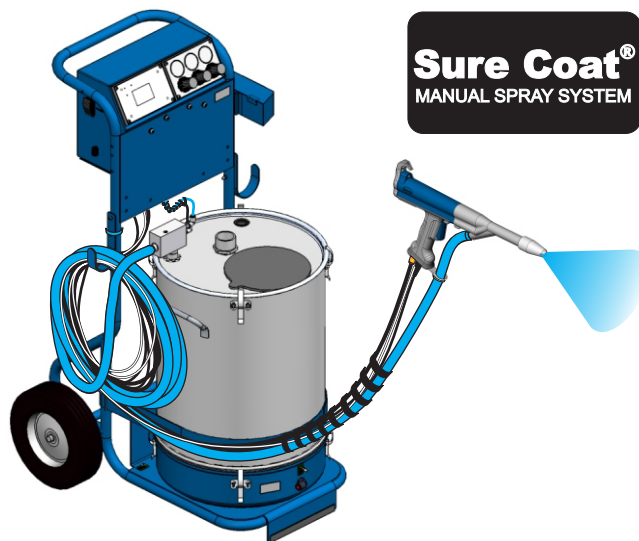


5

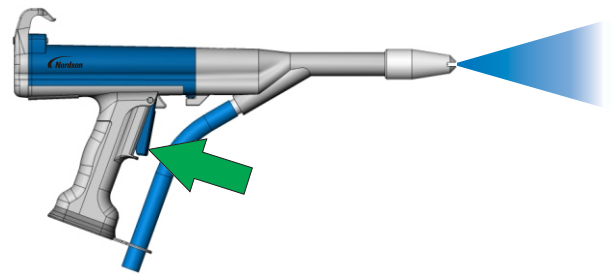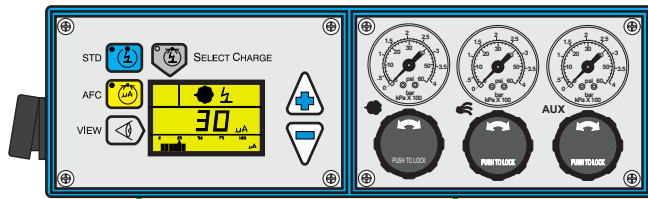



2 bar
(30 psi)

0.7 bar
(10 psi)

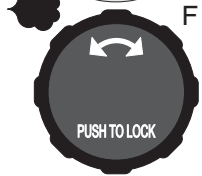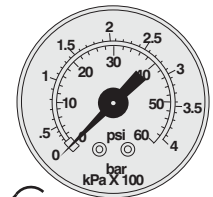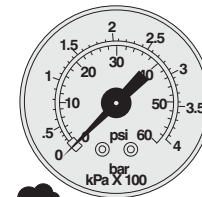


KV 

 μ A 

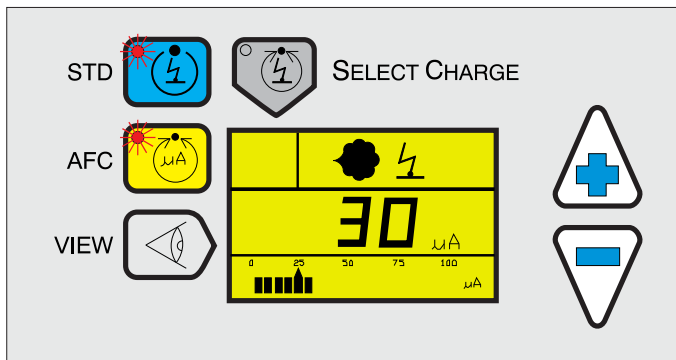
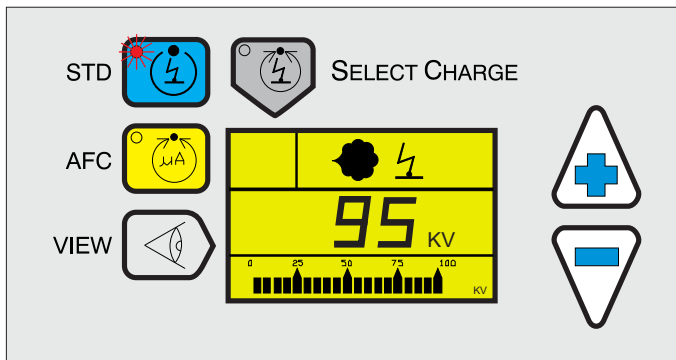



KV 


 μ A 

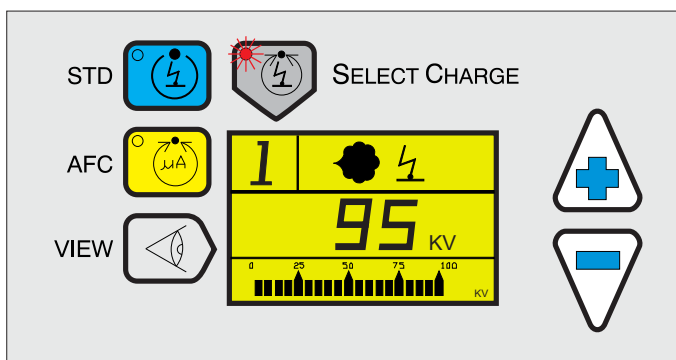- 1 = 95 KV, 15 μ A AFC 
- 2 = 95 KV, 50 μ A AFC 
- 3 = 95 KV, 70 μ A AFC 
- 4 = 60 KV, 30 μ A AFC 

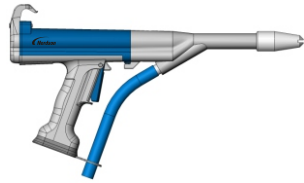
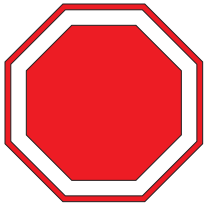


1

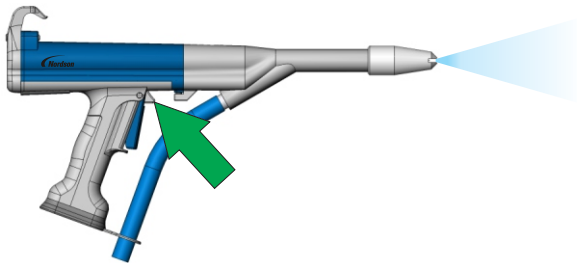


2


0 bar
(0 psi)

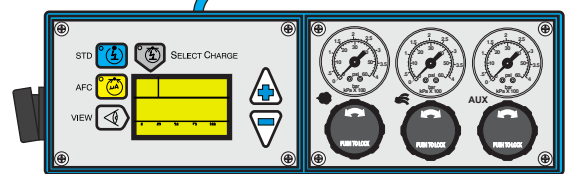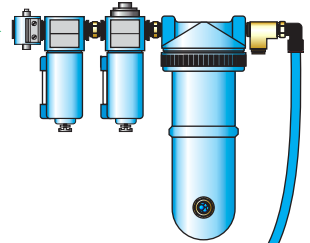


3

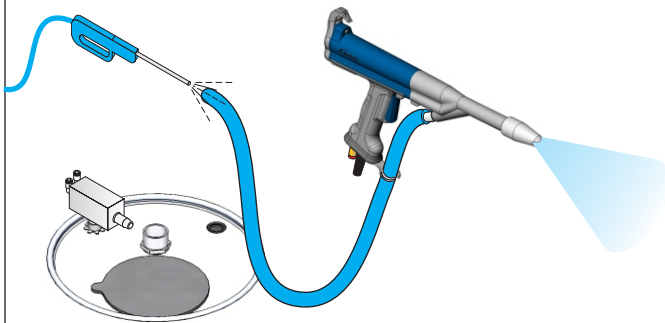


4



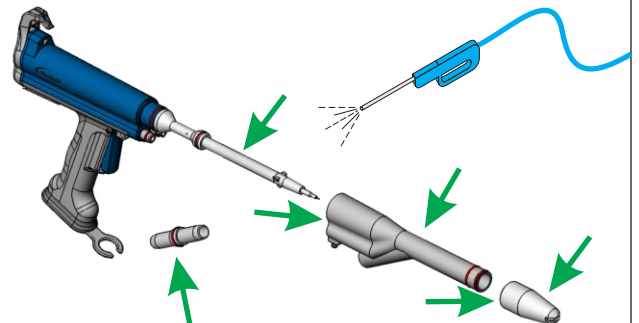


5

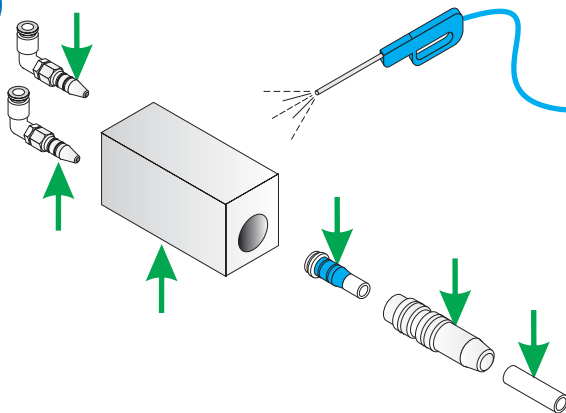

6

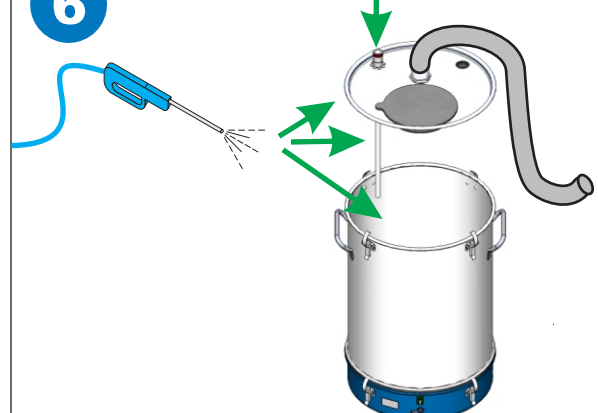

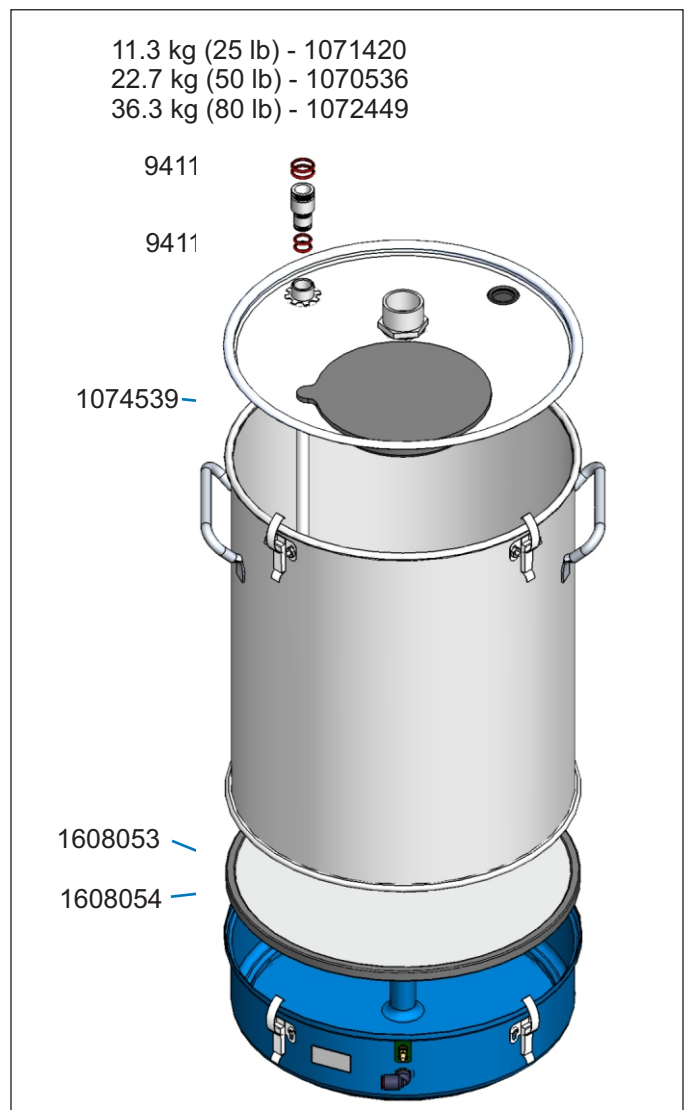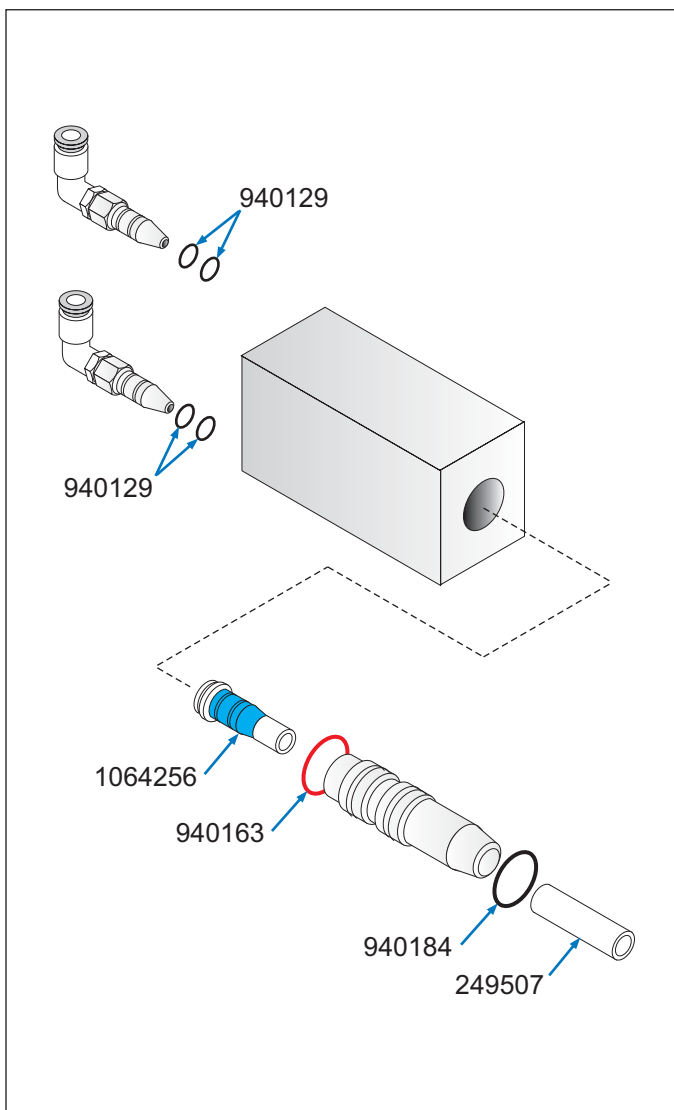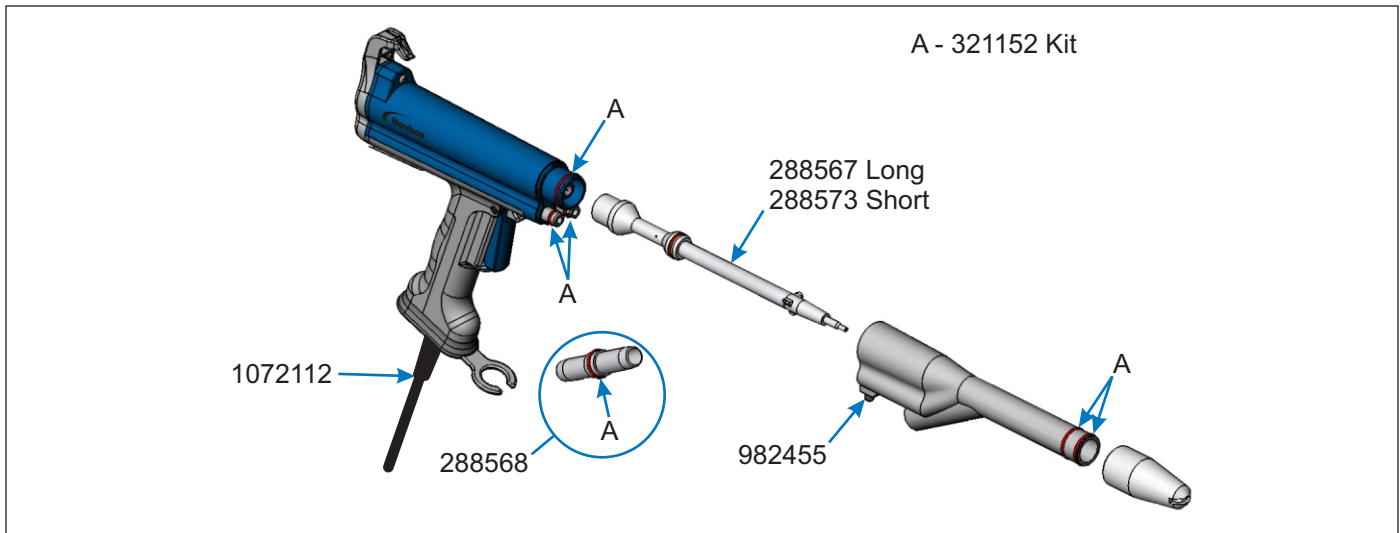

www.enordson.com



<http://emanuals.nordson.com>



www.nordson.com